

MOTOR PROTECTION RELAY, PHASE FAILURE/SINGLE-PHASE SENSITIVE. THREE-POLE (THREE-PHASE), MANUAL RESETTING. DIRECT MOUNTING ON BG06, BG09, BG12 MINI-CONTACTORS, 1.4...2.3A



Product designation			11RF9
Product type designation			Motor protection relay
General characteristics			
Number of poles		Nr.	3
Overvoltage category			III
Pollution degree			3
Frontal IP degree			IP20
Type of release			Thermal
Protection fuse			_
	gG (IEC)	Α	6
	aM (IEC)	Α	4
	RK5 (UL)	Α	10
Phase failure detection	,		yes
Reset mode			Manual
Power circuit characteristics			
Rated insulation voltage Ui IEC/EN		V	690
Rated impulse withstand voltage Uimp		kV	8
Rated operational voltage		V	690
Operational frequency			
,	min	Hz	0
	max	Hz	400
Operational current le			
•			
	Operational current min	Α	1.4
	Operational current min Operational current max	A A	1.4 2.3
Tripping class	Operational current min Operational current max	A A	2.3
Tripping class Test Button	-		2.3 10A
Test Button	-		2.3 10A Yes
Test Button Trip indicator	-		2.3 10A
Test Button	Operational current max		2.3 10A Yes yes
Test Button Trip indicator	-		2.3 10A Yes yes
Test Button Trip indicator	Operational current max		2.3 10A Yes yes
Test Button Trip indicator	Operational current max type screw		2.3 10A Yes yes screw and washer M4
Test Button Trip indicator	Operational current max type	A	2.3 10A Yes yes screw and washer M4 9.8
Test Button Trip indicator Terminals	Operational current max type screw width	A	2.3 10A Yes yes screw and washer M4
Test Button Trip indicator	Operational current max type screw width tool	A	2.3 10A Yes yes screw and washer M4 9.8 Phillips 2
Test Button Trip indicator Terminals	Operational current max type screw width	mm Nm	2.3 10A Yes yes screw and washer M4 9.8 Phillips 2
Test Button Trip indicator Terminals	Operational current max type screw width tool min max	mm Nm Nm	2.3 10A Yes yes screw and washer M4 9.8 Phillips 2 2.3 2.3
Test Button Trip indicator Terminals	Operational current max type screw width tool min	mm Nm	2.3 10A Yes yes screw and washer M4 9.8 Phillips 2
Test Button Trip indicator Terminals	Operational current max type screw width tool min max min	mm Nm Nm Ibin	2.3 10A Yes yes screw and washer M4 9.8 Phillips 2 2.3 2.3 1.7
Test Button Trip indicator Terminals Tightening torque for terminals	Operational current max type screw width tool min max min	mm Nm Nm Ibin	2.3 10A Yes yes screw and washer M4 9.8 Phillips 2 2.3 2.3 1.7
Test Button Trip indicator Terminals Tightening torque for terminals	type screw width tool min max min max	mm Nm Nm Ibin	2.3 10A Yes yes screw and washer M4 9.8 Phillips 2 2.3 2.3 1.7 1.7
Test Button Trip indicator Terminals Tightening torque for terminals Conductor section	type screw width tool min max min max	mm Nm Nm Ibin	2.3 10A Yes yes screw and washer M4 9.8 Phillips 2 2.3 2.3 1.7 1.7
Test Button Trip indicator Terminals Tightening torque for terminals Conductor section Auxiliary circuit characteristics	type screw width tool min max min max	mm Nm Nm Ibin	2.3 10A Yes yes screw and washer M4 9.8 Phillips 2 2.3 2.3 1.7 1.7
Test Button Trip indicator Terminals Tightening torque for terminals Conductor section Auxiliary circuit characteristics	type screw width tool min max min max AWG/kcmil max	mm Nm Nm Ibin Ibin	2.3 10A Yes yes screw and washer M4 9.8 Phillips 2 2.3 2.3 1.7 1.7




MOTOR PROTECTION RELAY, PHASE FAILURE/SINGLE-PHASE SENSITIVE. THREE-POLE (THREE-PHASE), MANUAL RESETTING. DIRECT MOUNTING ON BG06, BG09, BG12 MINI-CONTACTORS, 1.4...2.3A


Auxiliary Rated insulation voltage Ui IEC/EN		V	690
Auxiliary Rated impulse withstand voltage Uimp		kV	6
Auxiliary Rated operational voltage		V	690
Operating current AC15			
	24V	Α	3
	120V	Α	3
	240V	Α	1.5
	380V	Α	0.95
	480V	Α	0.75
	500V	Α	0.72
	600V	A	0.6
Operating current DC13	4.0-714		0.44
	125V	A	0.11
1500 11 11 11 11	600V	A	0.22
IEC Conventional free air thermal current Ith		Α	10
Terminals			1
	Auxiliary circuit type		screw and washer
	Auviliany airquit carayy		washer M3,5
	Auxiliary circuit screw Auxiliary circuit width	mm	1VI3,5 8
	Auxiliary circuit would Auxiliary circuit tool	111111	Phillips 1
Conductor section	Adamary Great tool		1 11111p3 1
Conductor Cocion	Auxiliary circuit Flexible w/o lug max	mm²	2.5
	Auxiliary circut Flexible c/w lug max	mm²	2.5
Tightening torque for terminals	, taxillary ellegt i lexible e, it lag max		2.0
riginorning torquo for terminate	Auxiliary circuit min	Nm	1
	Auxiliary circuit max	Nm	1
	Auxiliary circuit min	lbin	0.74
	Auxiliary circuit max	lbin	0.74
UL/CSA and IEC/EN 60947-5-1 designation	•		B600-P600
Ambient conditions			
Operating temperature			
	min	°C	-20
	max	°C	55
Storage temperature			
	min	°C	-55
	max	°C	70
Compensation temperature			
	min	°C	-15
	max	°C	55
Max altitude		m	3000
Mechanical features			
Operating position			
	normal		Vertical plan
	allowable		±30°
			Direct mounting
Fixing			on BG06
W/- '- La			BG09 BG12
Weight		g	116
UL technical data			
Full-load current (FLA) for three-phase AC motor	- 1001	Δ.	0.0
	at 480V	A	2.3
Dimensions	at 600V	Α	2.3
Dimensions			

ENERGY AND AUTOMATION

MOTOR PROTECTION RELAY, PHASE FAILURE/SINGLE-PHASE SENSITIVE. THREE-POLE (THREE-PHASE), MANUAL RESETTING. DIRECT MOUNTING ON BG06, BG09, BG12 MINI-CONTACTORS, 1.4...2.3A

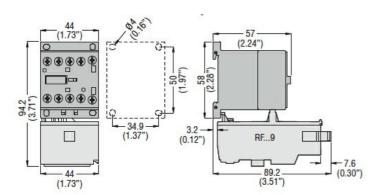

Wiring diagrams

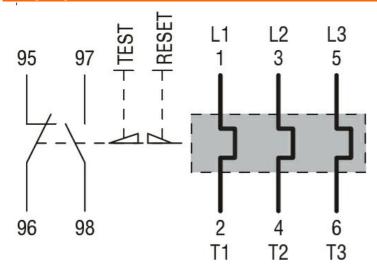

Certifications and compliance

Compliance

CSA C22.2 n° 14

IEC/EN 60947-1

IEC/EN 60947-4-1

UL508

Certifications

CCC

CSA

cULus

EAC

ETIM classification

ETIM 8.0

EC000106 -Thermal overload

relay